Ball Lock Pins • self-locking, with standard handle 22380.0133



Halder, Inc.

www.halderusa.com Page 1 of 4

Published on: 7.4.2024



Product Description

For quick fastening, locking, adjusting, changing and securing. Quickly and easily unlockable for frequently repeated connections.

All versions are corrosion resistant. When using stainless steel 1.4542: high-strength, hardened, abrasion resistant pin with high load capacity.

Compact design with standard handle.

Material

Pin part

 Stainless steel 1.4542, precipitationhardened

Spring

· Stainless steel

Operation

The balls are unlocked by pressing the button.

Characteristic

Types from stainless steel 1.4542 with marking below the balls.

More information

Notes

Special types on request.

Accessories


Can easily be fitted with retaining cable EH 22400.

Further products

- Ball Lock Pins, self-locking, with standard handle, titanium
- Locating Bushings, for ball lock pins and socket pins
- Locating Bushings, with flange, for ball lock pins and socket pins
- Retaining Cables
- Positioning Bushings, with collar, DIN 172 A
- Positioning Bushings, without collar, DIN 179 A

nc.

Drawing

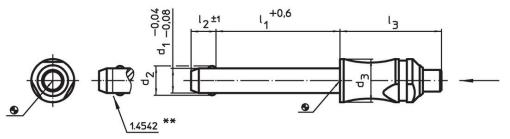

^{**} Types from stainless steel 1.4542 with marking.

Order information

Dimensions						Location hole		Ĭ	Shearing resistance,	Art. No.
d ₁ -0.04 -0.08	l ₁ +0.6	d ₂	d ₃	1 ₂ ±1	l ₃	пп	max.		two-shear ¹⁾ min.	
[mm]						[mm]	[°C]	[g]	[kN]	
Stainless steel										
25	90	30.8	28	22	49.9	25	250	551	631	22380.0133


¹⁾ Shearing resistance similar to DIN 50141

Application example



Halder, Inc.

www.halderusa.com Page 3 of 4
Published on: 7.4.2024

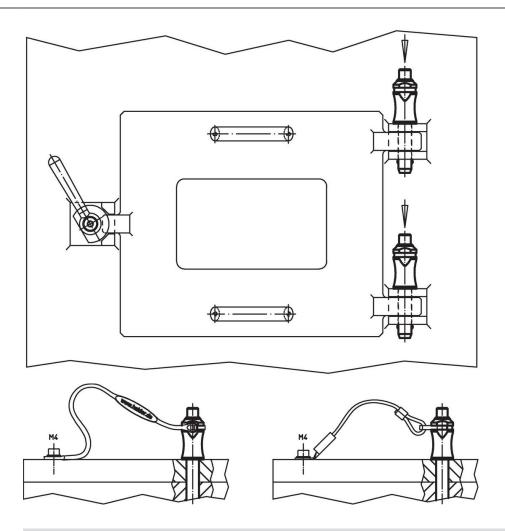

Compliance

RoHS compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 23.01.2024.

Halder, Inc.

Does not contain Proposition 65 substances

No Proposition 65 substances included.

https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halderusa.com Page 4 of 4

Published on: 7.4.2024