# Index Plungers • with hexagon collar

# 22120.0406



### **Product Description**

Index plungers are used for indexing bores.

#### **Material**

#### Body

Stainless steel 1.4305

### Locking pin

· Stainless steel 1.4305, nickel-plated

#### Knob

• Thermoplastic PA 6, black, dull

#### **Assembly**

The screw length can be adapted by distance collars for index plungers (EH 22120.).

#### More information

#### Notes


Knob not removable.

Lock nuts have to be purchased separately.

### **Further products**

- Mounting Blocks, for index bolts and index plungers, die-cast
- Locating Bushings, for index bolts and index plungers
- Distance Collars, for index plungers

### **Drawing**

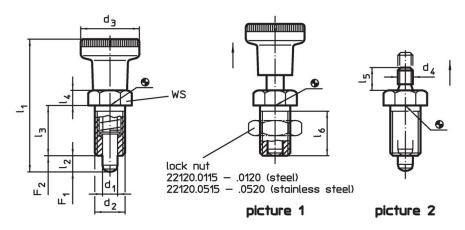

## Order information

Dimensions									Spring load <sup>1)</sup>				I	Art. No.
d <sub>1</sub>	d <sub>2</sub>	d <sub>3</sub>	l <sub>1</sub>	l <sub>2</sub>	l <sub>3</sub>	I <sub>4</sub>	I <sub>6</sub>		F <sub>1</sub>	$F_2$	min.	max.		
-0.02			~	min.			min.		~	~				
-0.05														
[mm]								[mm]	[N]		[°C	]	[g]	
with knob – picture 1, Stainless steel														
6	M12 x 1,5	25	54.5	6	20	6	17	14	6.5	19	-30	80	29	22120.0406

<sup>1)</sup> statistical average value



Halder, Inc.


www.halderusa.com

Published on: 4.2.2024

### **Accessories**

	Dimensions ${\sf d_2}$	Wrench size	Ĭ.	Art. No.					
	[mm]	[mm]	[9]						
Lock nuts ISO 8675 (DIN 439), Stainless steel									
	M12 x 1,5	18	7.5	22120.0516					

## **Application example**

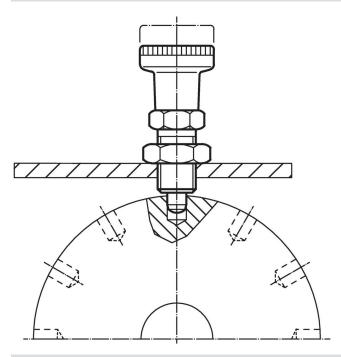

## Compliance

## **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

### Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 23.01.2024.

### Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

#### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



Halder, Inc. www.halderusa.com

Page 2 of 2 Published on: 4.2.2024